Figure 13. Microstructure unaffected by heat on the section through the fracture on the sample cut from rear spar sample CW1006. (Keller's etchant, 50X)

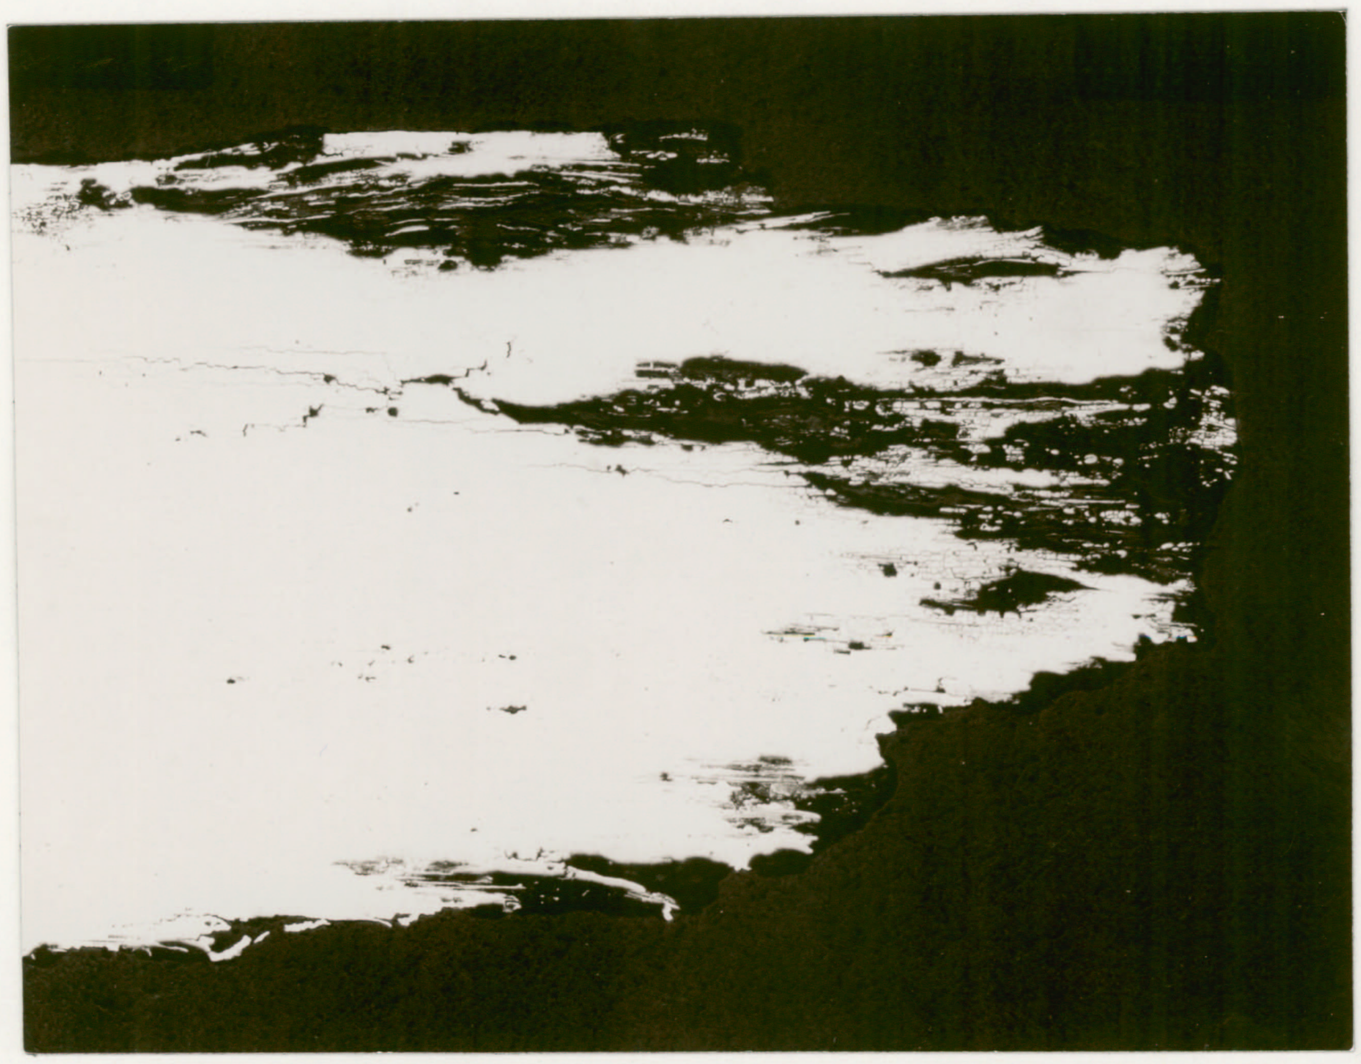

Figure 14. Corrosion damage penetrating preferentially along the boundaries of elongated grains on the section through the sample from rear spar piece CW1004. (As-polished, 25X)